

REPORT #:PJ21091456

INSPECTION REPORT

General Information					
From:	Source Ren	To Client:	The Luxury Men		
Contact:	Jack.Zhang	Contact:	Talha		


Product Description	Stylus Pens	
Item number	K811	
P/O number	N/A	E -
Supplier name	Shenzhen Ruidian Technology Co., Ltd.	
Factory Name	Shenzhen Ruidian Technology Co., Ltd.	
Inspection location	Longgang Shenzhen Guangdong China	
Inspector name	Rex Huang	
Inspection date	14-September-2021	

	PASS	FAIL	PENDING	NOT APPLICABLE	Special Attention
A: Quantity Available	\boxtimes				
B: Style and Color			\square		1, 7
C: Workmanship			\square		8
D: On Site Test			\square		3, 4, 5
E: Packing Method			\square		2, 6
CONCLUSION PENDING					

Sp	pecial Attention:
1.	No Client's approved sample for inspection reference.
2.	No shipping mark information on master carton and no any Packing / Marking spec were provided for reference.
3.	The factory did not agree to do internal check for product.
4.	The factory did not provide suitable equipment to conduct battery capacity and working current test.
5.	The factory did not agree to do the drop test during inspection.
6.	No item number on gift box and instruction manual.
7.	Shape of CE & FCC symbols were found same as client's photos, but not standard shape, and CE mark on
	gift box and instruction manual was 3.6mm and 2mm, less than 5mm, for built-in battery products, need
	WEEE mark on packaging and product.



REPORT #:PJ21091456

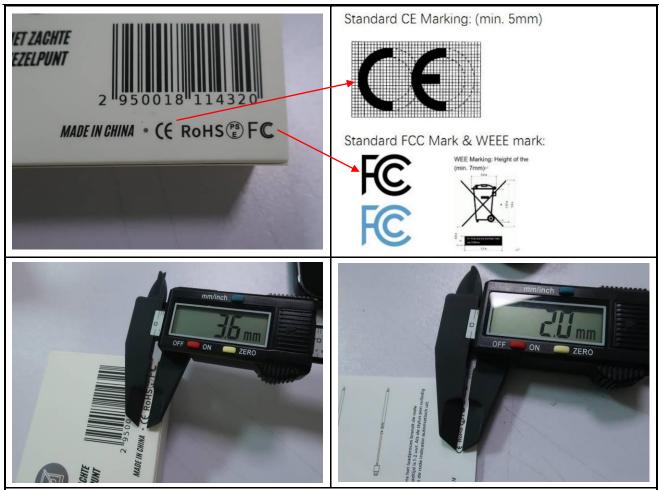

8. This was the 20% inspection according to client requirement, no applicable standard for reference, the result of workmanship was pending and subject to client decision.

Remark as per client's requirement:

- 1. How is the overall quality? Good and see section C
- 2. Try it in real time and tell us how it works and how is the touch feel? Good
- 3. Are the features okay? OK
- 4. Did they followed our requirements properly? our requirements includes the manual design and design box, also the logo on the product. Conformed
- 5. Open the stylus pen if possible to see what material they have used? And also test multiple stylus pens out on a device. Factory didn't agree to open product for internal check, and the product cannot change the leads.
- 6. How is the packaging feel, check for our logo and barcode, packaging is customized so check the manual as well. Good
- 7. Just overall good quality is very important. Yes
- 8. All the items are accurate and it there is any bad quality item change or replace it. Yes
- 9. Also compare data to the old reports of inspections. Yes



A: Quantity Available										
Po number	ltem Number	Order Qty	Shipm Qty / C	ent artons	Availal Qty / C		Packe Qty / 0	ed Cartons	Sample Qty / C	
N/A	K811	500	500	5	500	5	500	5	100	5
TOTAL		500	500	5	500	5	500	5	100	5
Comments	s: Nil	<u>.</u>		-			-	-	<u>.</u>	

B:S	B:Style and Color						
[☑ No sample ☐Supplier sample	Client sample					
	Supplementary information: 🗌 Photo 🛛 🗌 Purch	ase order 🗌 Specification 🗌 Ot	hers				
	CHECK POINTS	RESULT	COMMENTS				
1	Against product information on PO	□Pass □Fail □Pending	N/A				
2	Against product Specifications/Drawings /Photos	□Pass □Fail □Pending	N/A				
3	Against submitted Samples/ Color Swatch	□Pass □Fail ⊠Pending	Refer to SPA 1				
4	Against instruction manual/ other information on packaging/ product.	□Pass □Fail ⊠Pending	Refer to SPA 7				
Com	Comment: Nil						

3% of defective product		Fixed sam	Fixed sample size: 100pcs (20%)				
			Acceptable Quality Level (AQL): Critical: N/A Major: N/A Minor: N/A A Critical Defect = FAIL				
ITEM #	Defect De	scription		Critical	Major	Minor	
K811	Non-move	eable black	stain on head	0	0	2	
	Glue stair	n on ring		0	0	1	
			Number of Defects Found:	0	0	3	
			Number of Defect Allowed:	N/A	N/A	N/A	
Result:			Pending	Pending	Pending		



D:On Site T	est		
Test item	Samples Size	Criteria	Result
Scan the barcode	5 samples	Check scanned no. to match the printed no. on the barcode. Also check the barcode no. to match with the requirement.	⊠Pass
Carton Quantity Check	2 cartons	According to PO/Specification, check the quantity of each carton was conformed to the requirement.	⊠Pass
Carton assortment	2 cartons	According to PO/Specification, check the assortment of each carton was conformed to the requirement.	⊠Pass
Product measureme nt	5 samples	According to PO/Specification, check if the item dimension and weight was conformed to the requirement.	□Pass □Fail ⊠Pending
Carton dimension	2 cartons	According to PO/Specification, check if the carton dimension was conformed to the requirement.	□Pass □Fail ⊠Pending
Carton G.W	2 cartons	According to PO/Specification, check if the carton gross weight was conformed to the requirement.	□Pass □Fail ⊠Pending
Carton drop test	1 carton	ISTA-1A drop test is required at outer level for all products unless otherwise specified. One corner,3 angles, and 6 faces.	□Pass □Fail ⊠Pending
Assembly Check	5 samples	According to instruction manual or specification.	⊠Pass
General Function check	All samples	 -Verify all functions against available product specification, user manual and information on gift box. - If no notice available, use common sense to check the main function. 	⊠Pass

1



Your Quality Partner In The Factory

Data measurement -1						
14	Product size(cm)	Product weight(g	3)		
Item #	Requirement	Actual finding	Requirement	Actual finding		
		17.5LxФ9		16.0g		
		17.5LxФ9		16.3g		
K811	1	17.5LxФ9		16.6g		
		17.5LxФ9		16.2g		
		17.5LxФ9		16.5g		

Data measurement -2						
ltem #	Unit package		Master carton			
	Gross weight(g)	Dimension(cm)	Gross weight(kg)	Dimension(cm)		
K811	69.6g	21x6.2x2.1	7.55	44x33x25.5		
	69.8g	20.9x6.1x2.1	7.58	44x33x25.5		

E: Packing Meth	E: Packing Method				
	Corrugated Paper Plies:	☐Single Wall ⊠Double Wall ☐Triple Wall			
	Fastening:	☐Metal Staples ⊠Glue			
Outer packing	Sealed by:	☐Kraft Tape ☐Green Opaque Gummed Tape ⊠Transparent Gummed Tape			
	Strapping:	□Nylon Band ⊠No			
Outer packing quantity	100pieces per outer carton.				
Inner packing	N/A				
Unit packing Each unit was packed in a gift box together with instruction manual, USB ca and protected cap.					



REPORT #:PJ21091456

Photos attachment





Your Quality Partner In The Factory

REPORT #:PJ21091456



5. Factory in 702 of the building



6. Factory door



7. Factory



8. Warehouse













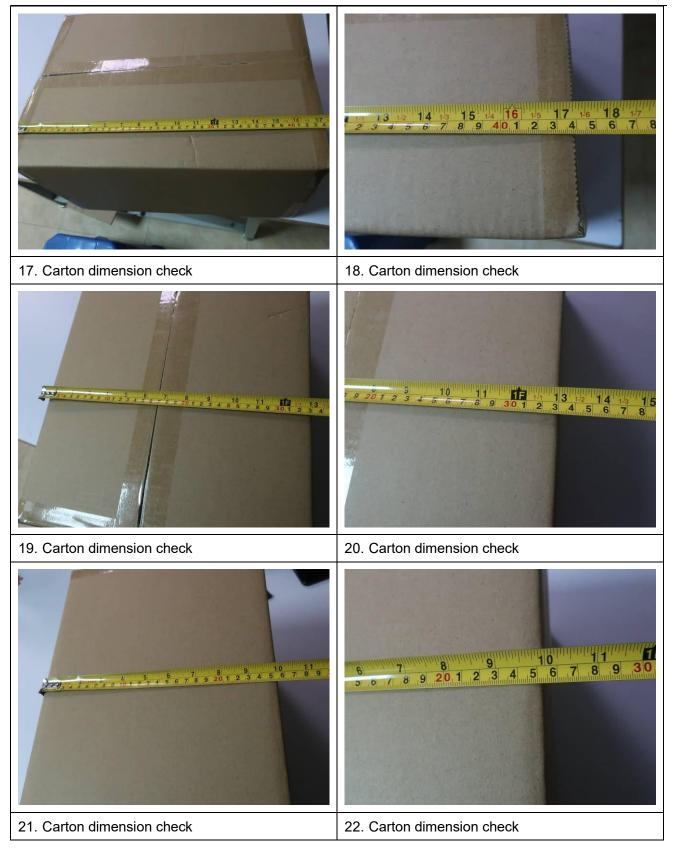








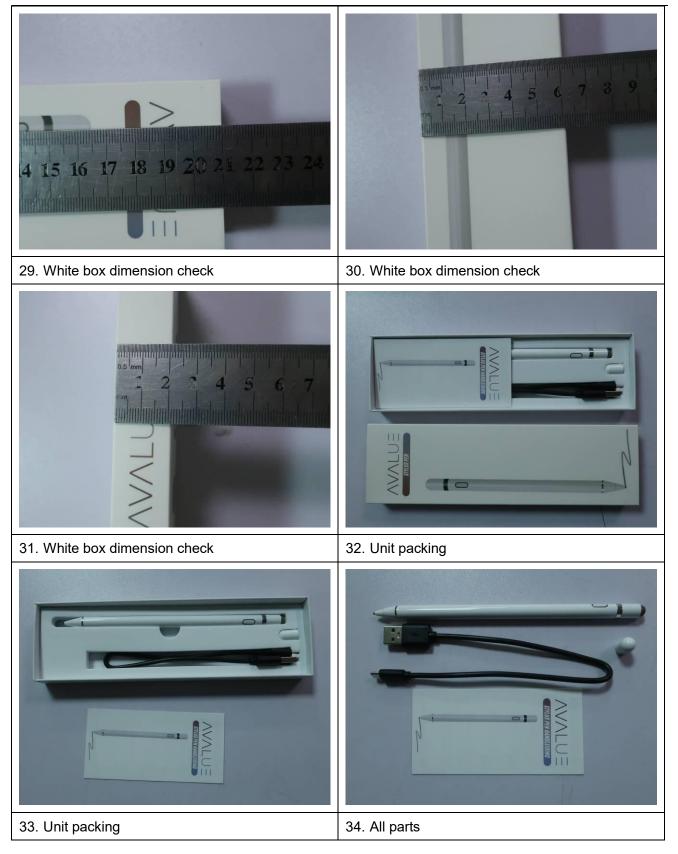




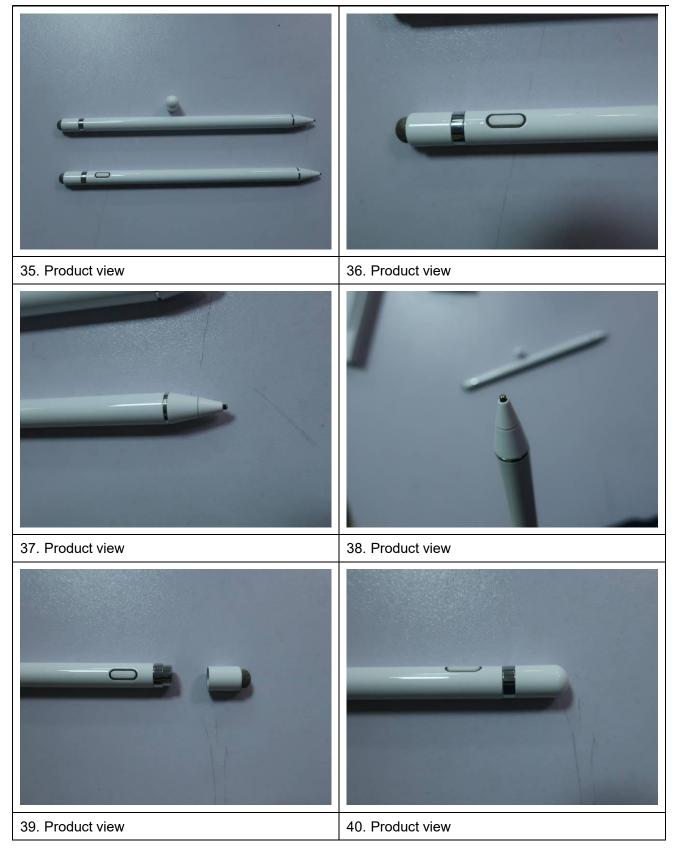




Your Quality Partner In The Factory

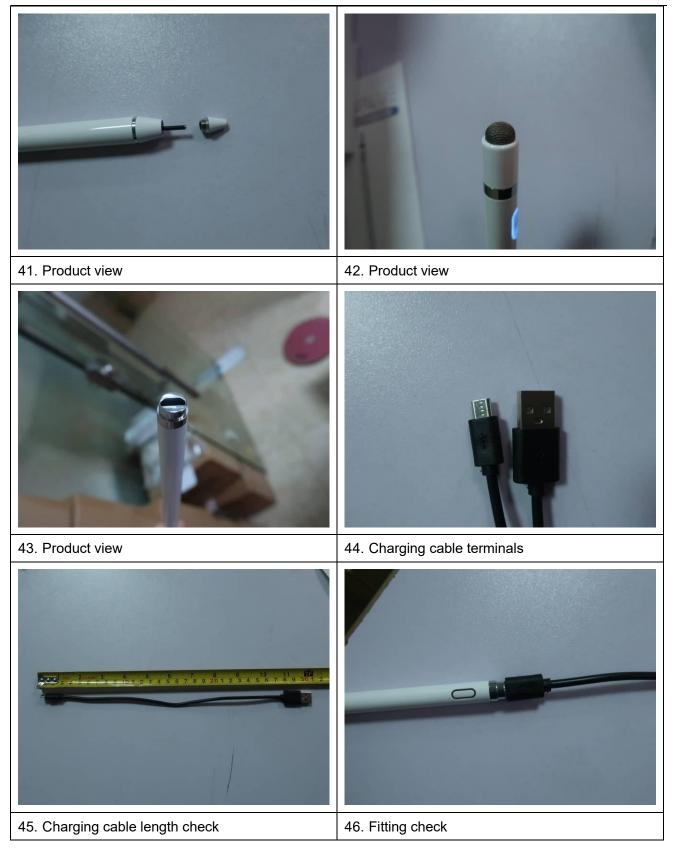



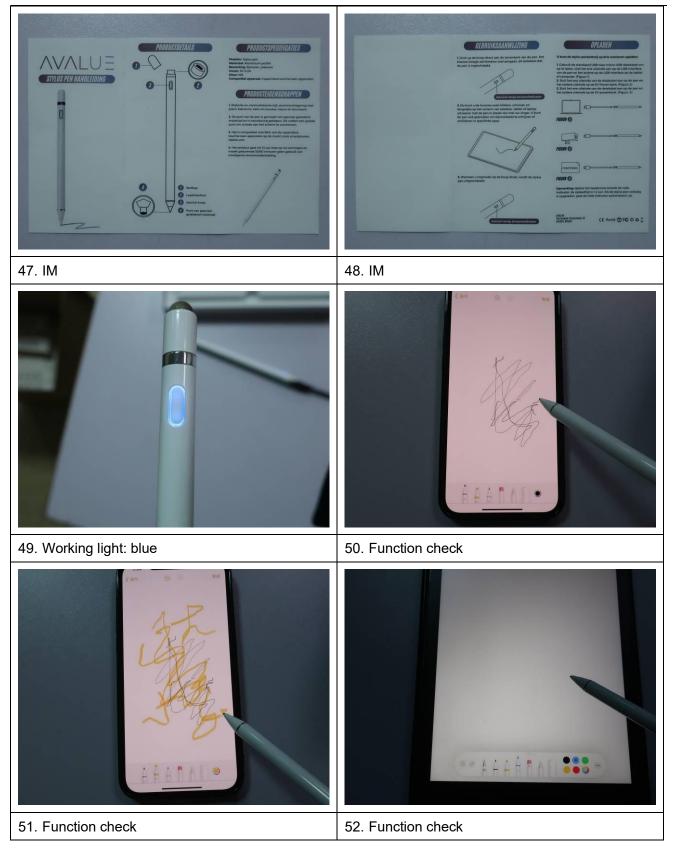


REN SOURCE

Your Quality Partner In The Factory

REPORT #:PJ21091456

Source Ren

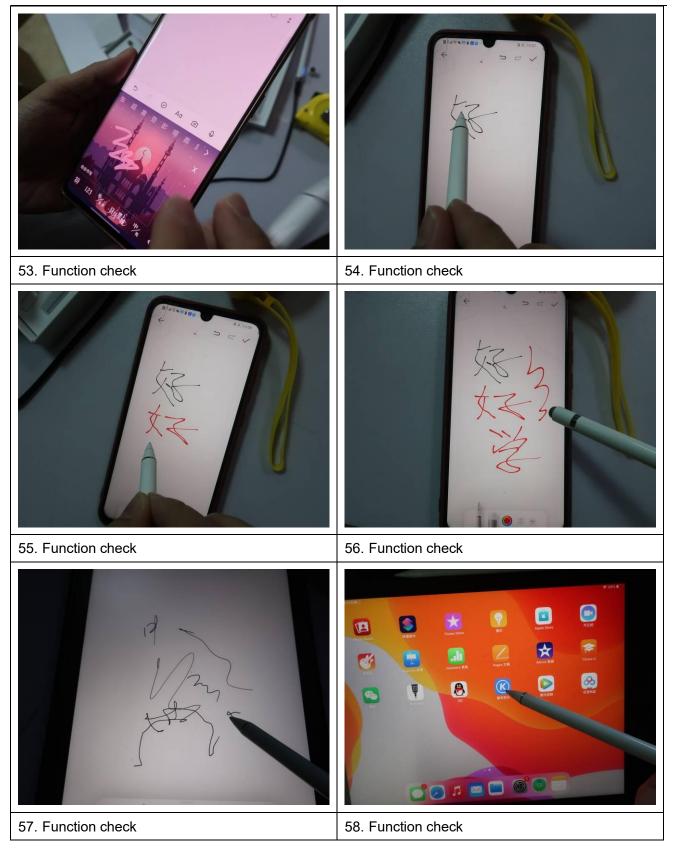

<u>CE</u> NT




Your Quality Partner In The Factory






Your Quality Partner In The Factory

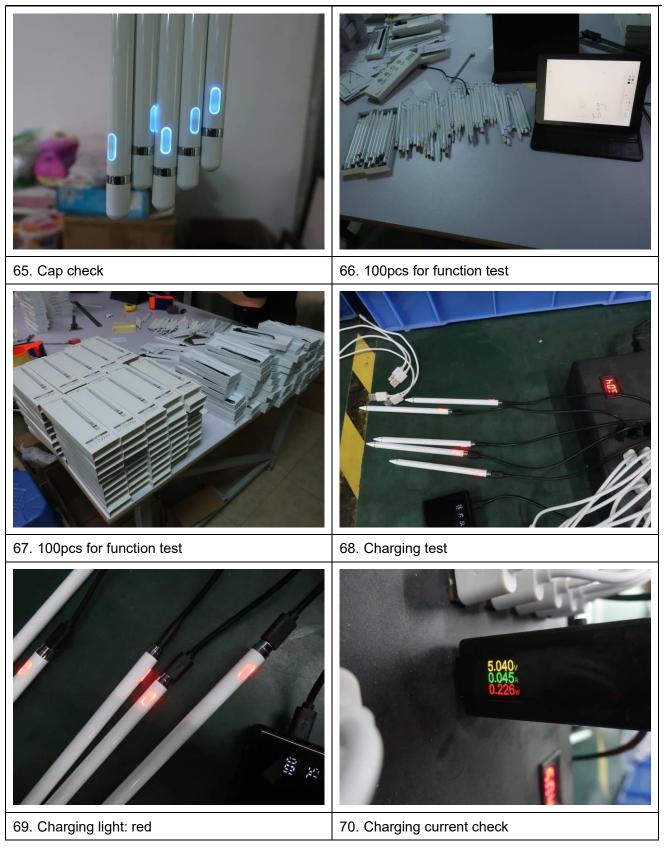




Your Quality Partner In The Factory

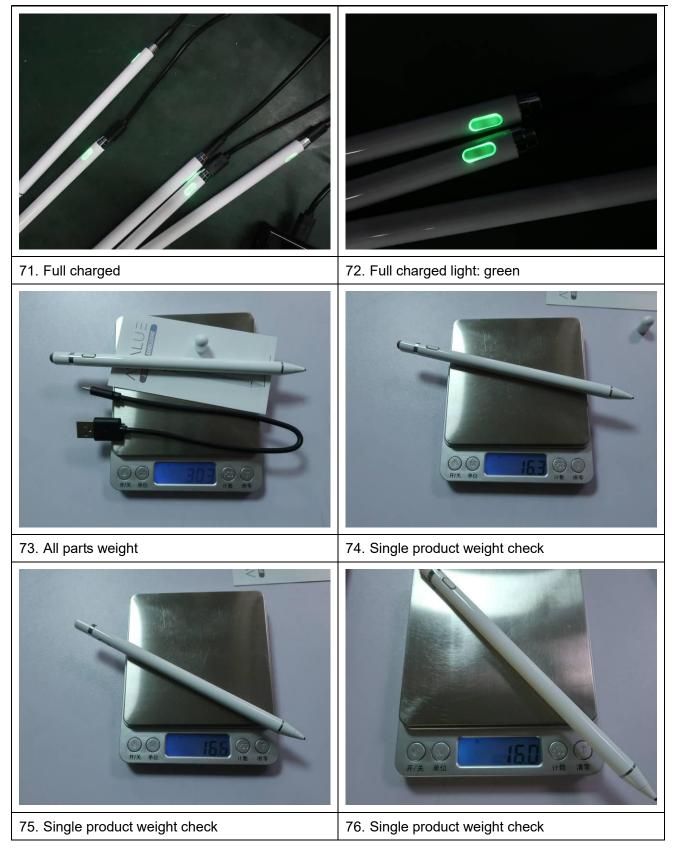



Your Quality Partner In The Factory

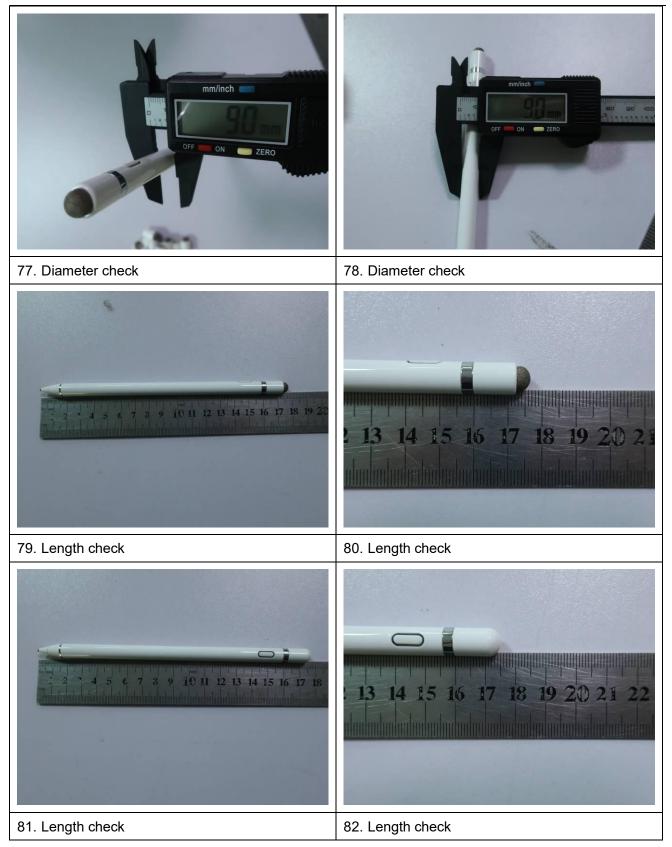


REN SOURCE

Your Quality Partner In The Factory

REPORT #:PJ21091456

Source Ren

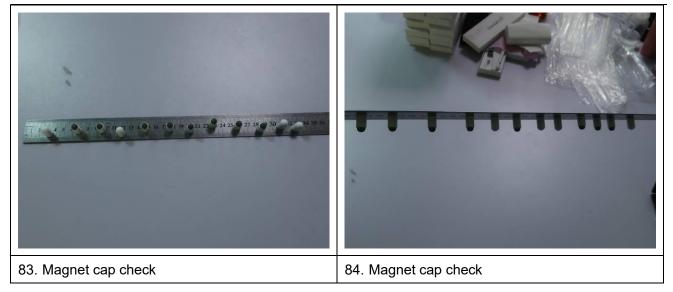

The above reflects our findings at time and place of inspection. This report does not relieve sellers/suppliers from their contractual obligations regarding quantity and/or quality of this delivery. This report is issued without prejudice to liability and the information contained herein is to the best of our knowledge and belief, true and correct. This document shall not be reproduced either in full or in part except with written approved by the Authorized Representative of PinJi.